Technical Service Bulletin

SUBJECT: DOME LAMP ASSEMBLY SWITCH SLIDE REPLACEMENT			No: TSB–11–54–004
			DATE: March, 2011
			MODEL: 2006–11 Endeavor
CIRCULATE TO:	[ ] GENERAL MANAGER	[X] PARTS MANAGER	[X] TECHNICIAN
[X] SERVICE ADVISOR	[X] SERVICE MANAGER	[X] WARRANTY PROCESSOR	[ ] SALES MANAGER

PURPOSE

A tab on the switch slide for the front dome lamp may break and prevent the switch from moving between the different positions. The switch slide is now available as a service part (P/N 8401A024YA & 8401A024HA) and it is no longer necessary to replace the complete dome lamp assembly for a broken switch slide.

AFFECTED VEHICLES

2004–2011 Endeavor

REPAIR PROCEDURE

Use the following procedure to replace the front dome lamp switch slide.

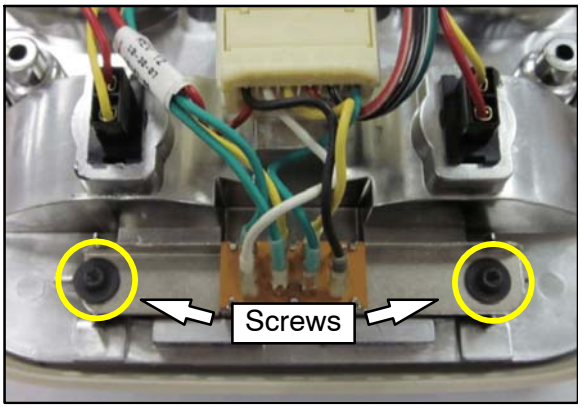

1. Remove the the room lamp assembly using the procedure outlined in Group 54A Chassis Electrical of the service manual.
2. Place the switch in the DOOR (center) position.
3. Remove the switch screws (2) from the back of the assembly.

Continued

Copyright 2011, Mitsubishi Motors North America, Inc.

The information contained in this bulletin is subject to change. For the latest version of this document, go to the Mitsubishi Dealer Link, MEDIC, or the Mitsubishi Service Information website *(www.mitsubishitechinfo.com)*.

4. Using a small flat blade screwdriver:
   a. Lift the right front clip from the slide channel.
   b. Lift the left front clip from slide channel.

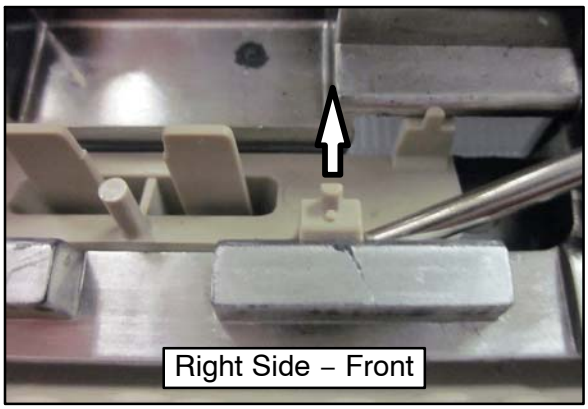
Right Side – Front

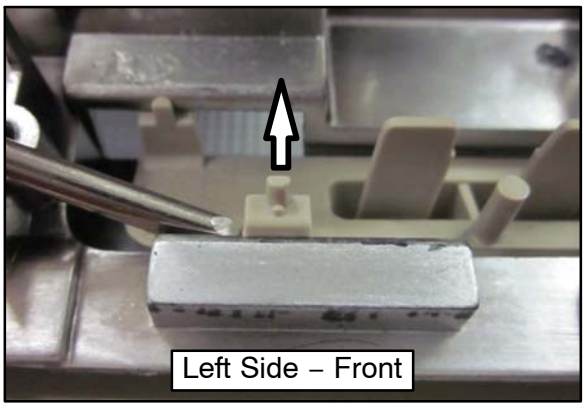
Left Side – Front

5. Using a small flat blade screwdriver:
   a. Lift the right rear clip from the slide channel.
   b. Lift the switch slide from the assembly.

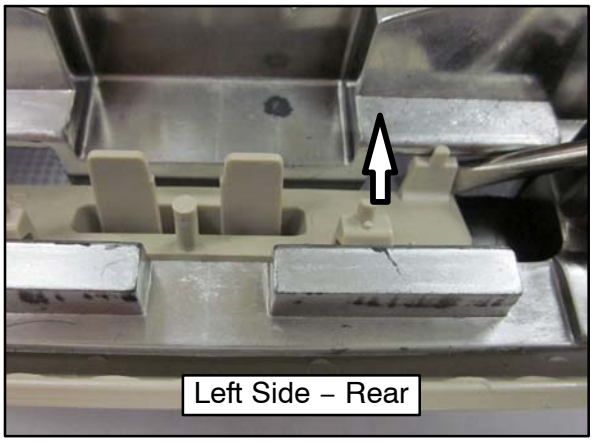
Left Side – Rear

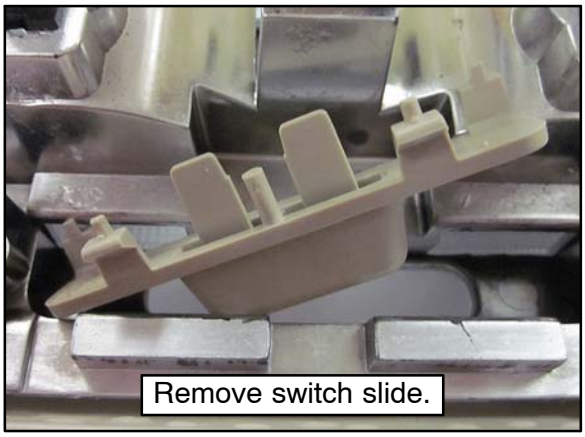
Remove switch slide.

6. Install the new switch slide.
   a. Place the new switch slide in position as shown in the photo
   b. Using both thumbs to apply light pressure, snap the right side into the channel with your right thumb.
   c. Repeat for the left side.

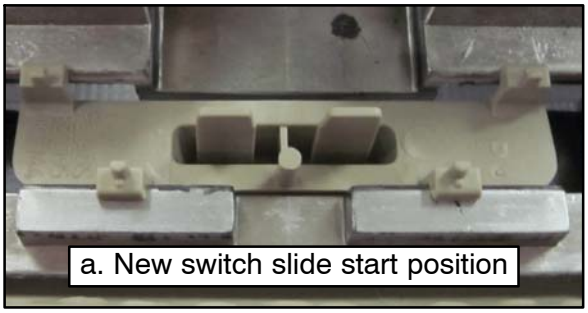
a. New switch slide start position

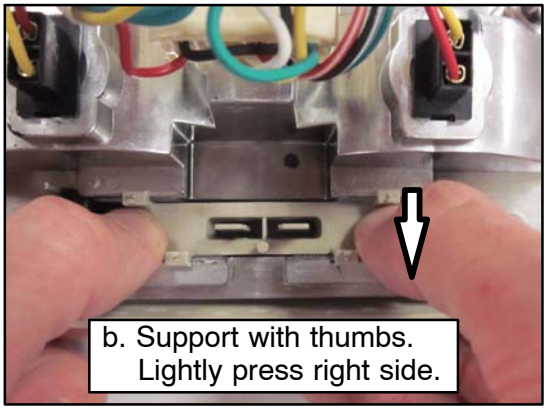
b. Support with thumbs.
Lightly press right side.

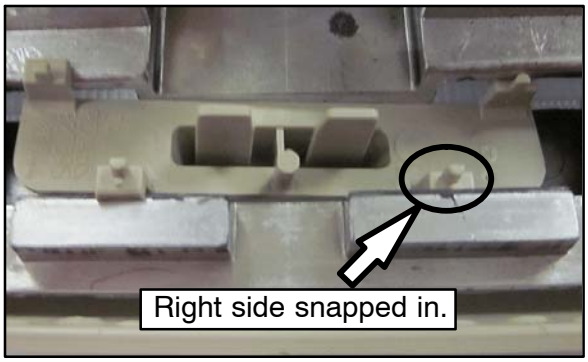

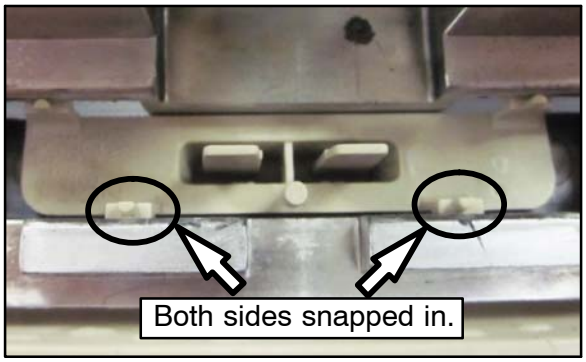

7. Install the switch to the dome lamp assembly. Ensure the black switch tab is placed between the slide tabs as shown.
8. Reinstall the screws.

!!CAUTION!!
No torque specification is given for the screws. DO NOT over tighten.

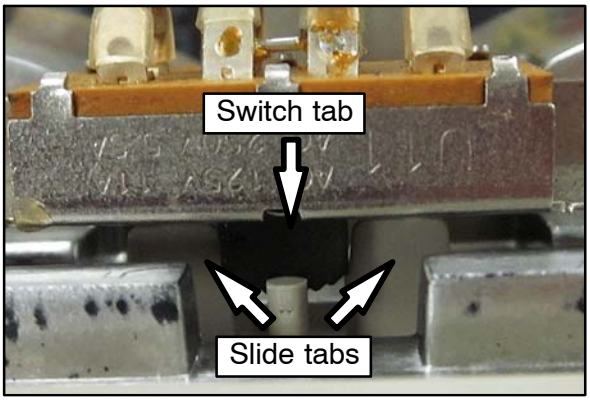

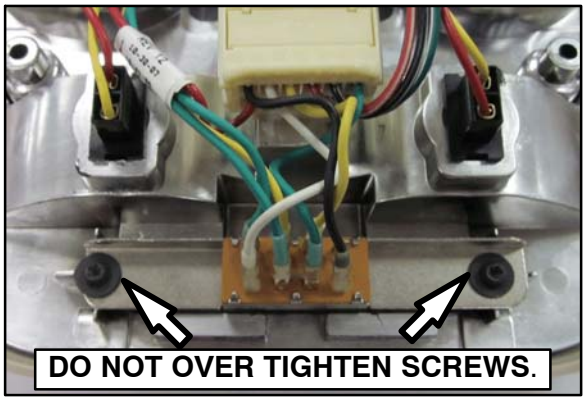

9. Connect the switch to the harness and confirm proper dome lamp operation.
10. Reinstall the dome lamp assembly.

PARTS INFORMATION

Use only the Genuine Mitsubishi Parts listed below.

Description	Part Number
Courtesy Button, Beige	8401A024YA
Courtesy Button, Gray	8401A024HA

WARRANTY INFORMATION

This bulletin is supplied as technical information only and is not an authorization to repair. If an affected vehicle is reported with the described condition, diagnose the condition, repair as described in this bulletin and submit a normal warranty claim.

Dome Lamp Switch Slide Replacement

Nature Code: 59Z *Cause Code:* 111

Labor Operation No.: 541810 91 *Time Allowance:* 0.3 hrs

Warranty Coverage: Basic Coverage – Refer to the Superscreen for individual vehicle warranty coverage terms.

Special Warranty Information: Normal warranty procedures apply.